

# **Series HHT Hazardous Area Humidity/Temperature Transmitter**


## **Specifications - Installation and Operating Instructions**



The Series HHT Hazardous Area Humidity/Temperature Transmitter takes accurate measurements in the harshest of environments. The transmitter is offered in explosion-proof and intrinsically-safe versions depending on the applications requirements. The explosion-proof model is offered with 4 to 20 mA outputs for humidity only. The intrinsically-safe version is offered with 4 to 20 mA output for humidity and temperature. Both versions have an optional two line alphanumeric display to show the current humidity and temperature.

The Series HHT humidity/temperature transmitter is excellent for offshore HVAC applications, dust and grain applications.

Model	Protection	Description	Display
HHT-EU	Explosion-Proof	Humidity	No
HHT-IU	Intrinsically Safe	Humidity	No
HHT-IT	Intrinsically Safe	Humidity/Temperature	No
HHT-EU-LCD	Explosion-Proof	Humidity	Yes
HHT-IT-LCD	Intrinsically Safe	Humidity/Temperature	Yes

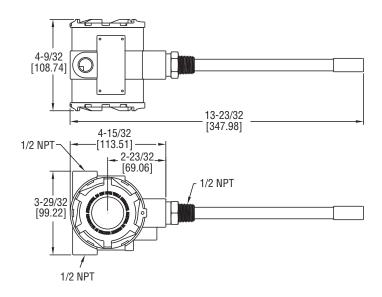

### **SPECIFICATIONS**

Relative Humidity Range: 0 to 100% RH. Temperature Range: -40 to 140°F (-40 to 60°C).

Accuracy: ±2% 10-90% RH, ±0.9°F at 72°F (±0.3°C at 25°C).

Hysteresis: ±1%.

Repeatability: ±0.1% typical.

Temperature Limits: -40 to 140°F (-40 to 60°C).

Storage Temperature: -40 to 176°F (-40 to 80°C).

Compensated Temperature: -40 to 140°F (-40 to 60°C).

Power Requirements: For intrinsically safe models HHT-IX, 9.5 to 28 VDC. For explosion-proof models HHT-EX, 16.5 to 28 VDC.

Output Signal: 4-20 mA, 2 channels for humidity/temperature

models (loop power on RH). **Response Time:** 15 seconds.

Electrical Connections: Screw terminal block.

Conduit Connection: 1/2 female NPT.

Drift: <1% RH/year.

RH Sensor: Capacitance polymer.

Temperature Sensor: Solid state band gap.

Housing Material: Aluminum.

Display: Optional 2 line alpha numeric, 8 characters/line.

Temperature

Phone: 219/879-8000

display is °F/°C selectable.


**Display Resolution:** RH: 0.1%: Temperature 0.1°F (0.1°C).

Weight: 2 lb 8 oz (1134 g).

**Agency Approvals:** FM Approved to: XP-IS / I / 1 / BCD / T5 Ta =  $-40^{\circ}$ C to  $60^{\circ}$ C, DIP / II, III / T5 Ta =  $-40^{\circ}$ C to  $60^{\circ}$ C; TYPE 4X, IP66; IS / I, II, III / 1 / ABCDEFG / T4 Ta =  $-40^{\circ}$ C to  $60^{\circ}$ C - 01-001467-00; ENTITY; TYPE 4X, IP 66; I / 0 / AEx ia / IIC / T4 Ta =  $-40^{\circ}$ C to  $60^{\circ}$ C - 01-001467-00; ENTITY; TYPE 4X, IP 66, CE.

# Wiring Diagram – Humidity Only Explosion Proof Installation Notes:

- Install in accordance with any applicable national electric code.
- Plug unused conduit openings. Plug must engage a minimum of 5 threads.
- 3. Use conduit seal within 18 inches of conduit entry.
- 4. Disconnect power before servicing.
- Control equipment voltage on hazardous side is 250 Vrms/DC maximum.
- Do not substitute any components. The intrinsic safety of the sensor may be compromised.
- 7. Shielded cable for 4-20 mA loop is necessary to meet CE requirements or when used in electrically noisy environments.

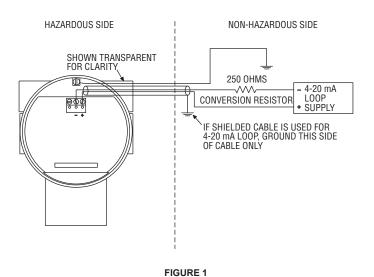

## **Entity Parameters:**

Vmax = 28 VDC Imax = 100 mA Ci = 62 nF Li = 7.7 µH Pi = 651 mW

# Wiring Diagram – Humidity and Temperature Intrinsically Safe Installation Notes:

- Remove power from the instrument before carrying out any servicing.
- Use only FM approved Associated Apparatus. When installing the Associated Apparatus, the manufacturer's instructions must be followed.
- 3. The earth terminal on the housing must be wired to a local earth ground in the hazardous area.
- 4. Refer to FM control drawing, Dwyer number 03-001467-00.
- For Model HHT-IT, use <u>ONLY</u> Pepperl + Fuchs KFDØ-SCS-Ex1.55 Galvanically Isolated Barriers.


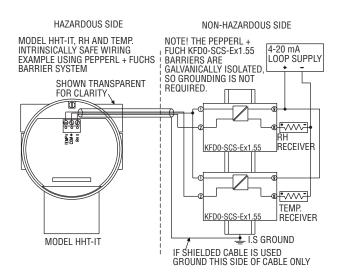


FIGURE 2

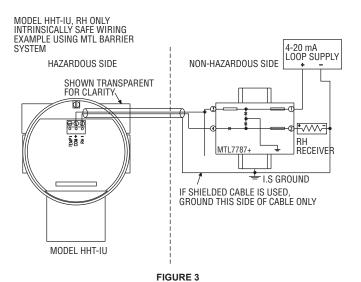

#### **Power Supply Requirements:**

The maximum DC Power Supply is 28 VDC. The minimum required DC Power Supply required is based upon the following:

- 1. Minimum DC voltage requirement of the Model HHT.
- 2. Total load resistance.
- 3. Total leadwire resistance.
- 4. Zener barrier voltage drop (Model HHT-IX only).

The formula for calculating the DC Power Supply is: VDC = VHHT + VLOAD + VLEADWIRE + VBARRIER

Where VHHT = 9.5v for Models HHT-IX and 16.5v for Models HHT-EX.

VLOAD = Total load resistance X 20mA VLEADWIRE = Total leadwire resistance X 20mA VBARRIER = 8.1v

(Typical zener barrier voltage drop for this application)

# Example 1. Calculate minimum DC Power Supply for Model HHT-EX (Explosion Proof)

Step 1. VHHT = Minimum voltage required by Model HHT-EX = 16.5 v

Step 2. Calculate VLOAD. Using the industry standard 250 OHM conversion resistor, VLOAD = 250 X 20mA = 5v.

Step 3. Calculate VLEADWIRE. For this example assume a leadwire resistance of 10 OHMS.

VLEADWIRE =  $10 \times 20$ mA = 0.2v

Step 4. VDC = VHHT + VLOAD + VLEADWIRE = 16.5 + 5 + 0.2 = 21.2v

# Example 2. Calculate minimum DC Power Supply for Model HHT-IU (Intrinsically Safe)

Step 1. VHHT = Minimum voltage required by Model HHT-IX = 9.5 v

Step 2. Calculate VLOAD. Using the industry standard 250 OHM conversion resistor, VLOAD = 250 X 20mA = 5v.

Step 3. Calculate VLEADWIRE. For this example assume a leadwire resistance of 10 OHMS.

VLEADWIRE = 10 X 20mA = 0.2v

Step 4. VBARRIER = 8.1v

Step 5. VDC = VHHT + VLOAD + VLEADWIRE + VBARRIER = 9.5 + 5 + 0.2 +8.1 = 22.8v

For Model HHT-IT, follow instructions with Pepperl + Fuchs KFDØ-SCS-Ex1.55 Barrier.

### **INSTALLATION**

**Location:** Select a location where the ambient temperature is between –40 to +140°F (-40 to +60°C)


**Position:** The transmitter is not position sensitive. Units with the optional display should be mounted for ease of viewing the display.

**Caution:** Use electrostatic discharge precautions (e.g. use of wrist straps) during installation and wiring to prevent equipment damage.

Avoid locations where severe shock or vibration, excessive moisture or corrosive fumes are present.

Do not exceed ratings of this device. Permanent damage not covered by the warranty may result.

**Display:** The temperature indicated on the display, if equipped with the LCD option, is field selectable via a jumper located on the circuit board just above the display. To change the jumper position, remove the housing cover and position the jumper for °F or °C according to Figure 4.

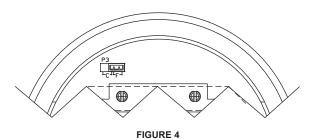

### Replaceable RH/Temperature sensor and sintered filter:

Replacement sensors are available. No calibration is required when a new sensor is installed. To replace the sensor, remove the sintered filter. When installing the new sensor, make sure the 4 pin male connector is aligned correctly with the female connector. See Figure 5.

To order a replacement sensor or sintered filter, contact Dwyer sales. The part numbers are:

Replacement 2% sensor : A-451 Replacement sintered filter: A-450


 


FIGURE 5

### **MAINTENANCE**

Upon final installation of the Series HHT Hazardous Area Humidity / Temperature Transmitter, it is important to develop a routine schedule for replacing the RH/Temperature Sensor P/N A-451. The sensor should be replaced annually or sooner depending on environmental conditions. A periodic check of system calibration is recommended. The Series HHT is not field serviceable and should be returned if repair is needed (field repair should not be attempted and may void warranty). Be sure to include a brief description of the problem plus any relevant application notes. Contact customer service to receive a return goods authorization number before shipping.

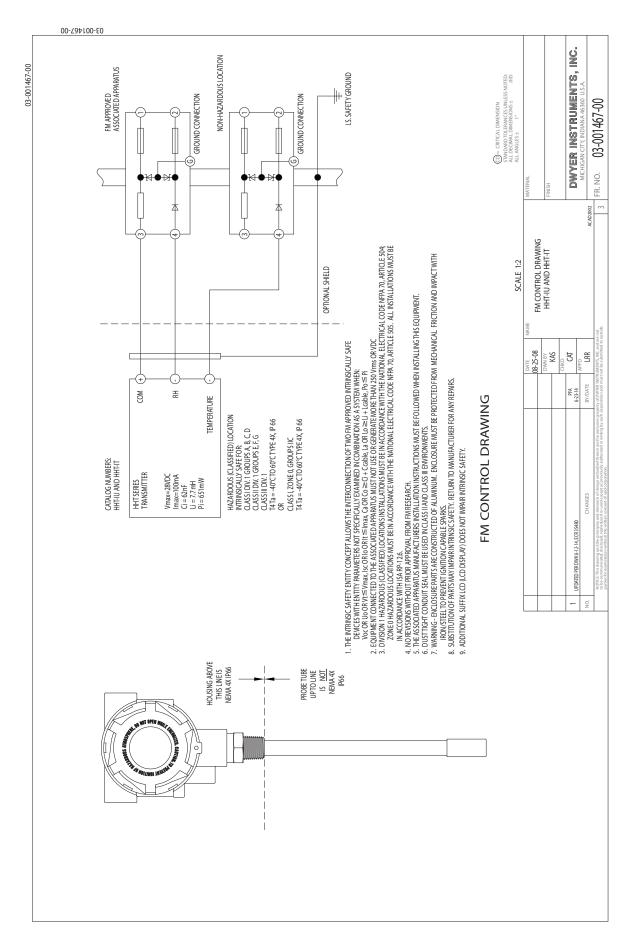

©Copyright 2014 Dwyer Instruments, Inc.

Printed in U.S.A. 12/14

Phone: 219/879-8000

Fax: 219/872-9057

FR# 03-443603-00 Rev. 6